

# TECHNICAL TOPICS

## POWERTRAIN



### U0111-00 Lost Communication with Battery Energy Control Module "A"

### 19-22MY Range Rover, RR Sport

#### Customer Voice:

- Charge warning light on, MIL light

#### Technical Description:

- DTC U0111-00 Lost Communication with Battery Energy Control Module "A" will come on
- Incorrect Battery Energy Control Module (BECM) harness routing causing tension on connector C4YB01D resulting in high resistance/open circuit.

#### Status:

- Remove the original clipping feature on the MHEV Battery harness and replace with a suitable cable tie (200mm x 4.8mm) making sure the harness is routed correctly and not tight putting the harness under stress as per the attachment and check for connector damage and repair if required.

Refer to SSM 75783

