Document ID: 1959427 Page 1 of 4

2007 Chevrolet Corvette | Corvette VIN Y Service Manual | Document ID: 1959427

#06-02-32-012B: Power Steering Shudder or Vibration at Idle (Replace Power Steering Inlet (Pressure) Hose) - (Apr 12, 2007)

Subject: Power Steering Shudder or Vibration at Idle (Replace Power

Steering Inlet (Pressure) Hose)

Models: 2005-2007 Chevrolet Corvette

with Automatic Transmission



This bulletin is being revised to add 2007 model year. Please discard Corporate Bulletin Number 06-03-32-012A (Section 02 -- Steering).

Condition

Some customers may comment on a shudder/vibration while rotating the steering wheel at idle. This vibration can be very minor to where it is only felt in the steering wheel or major enough to notice a slight shake in the interior components. Rougher road surfaces can increase the intensity as it increases the drag against the wheels as they attempt to turn. Slightly raising the engine idle should eliminate the vibration.

Cause

At idle, turning the wheels causes the steering pressures to raise high enough to cause a load on the engine. The load is great enough to cause the idle to become rough and it can be felt in the vehicle.


Correction


Replace the power steering inlet (pressure) hose with a revised hose. Refer to the pictures below for new hose routing.

Vehicles with FE1 and FE2 Suspension

© 2011 General Motors. All rights reserved.

 
Document ID: 1959427 Page 2 of 4

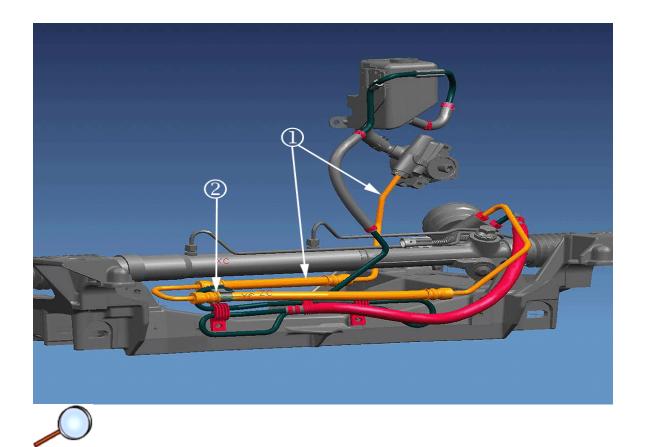



Vehicles FE3 and FE4 Suspension

Document ID: 1959427 Page 3 of 4

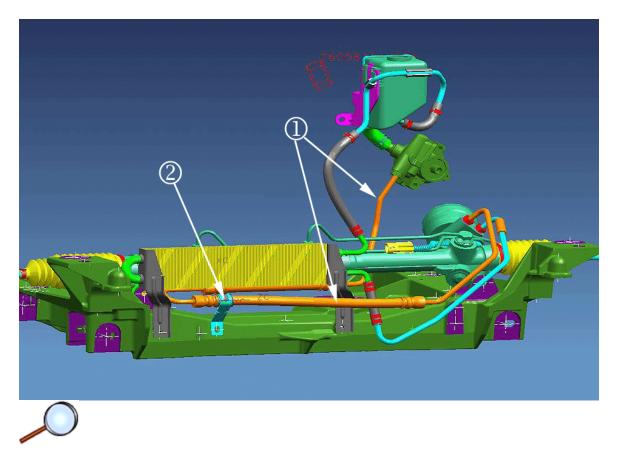

For vehicles with either FE3 or FE4 suspension, a screw, P/N 11609268, is also required. After installing the new hose (1), secure the clip (2) to the front crossmember with the screw.

Tighten

Tighten the screw to 27 N⋅m(20 lb ft).

Parts Information

Part Number	Description	
15903239		
	Power Steering Inlet (Pressure) Hose	
(FE1/FE2 Suspension)		
15903240		
	Power Steering Inlet (Pressure) Hose	
(FE3/FE4 Suspension)		
88967174		
	Clip	
(FE1/FE2 Suspension)		
11609268		
	Screw	
(FE3/FE4 Suspension)		

Warranty Information

Document ID: 1959427 Page 4 of 4

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E8622	Hose, Power Steering Hydraulic Pressure Replace	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

