## ASA5545-FPWR-K9 Datasheet

Get a Quote



## Overview

ASA5545-FPWR-K9 firewall is the entry-level next-generation firewall system. It is designed for big-size enterprise. The next-generation firewall combines with FirePower services which offers greater visibility and automation with superior response to protect the network. it offers the industry's first adaptive threat focus nextgeneration firewall which includes SourceFires next-generation Intrusion Prevention System or engine IPS and advanced Malware capabilities, this comprehensive next-generation solution lowers costs in simplifies complexity. Cisco's integrated approach correlated threats with vulnerabilities to determine their impact.


### **Quick Specs**

Table 1 shows the Quick Specs.

Product Code	ASA5545-FPWR-K9
Firepower service	Supported, including Firesight management Center, ASDM 9.X
Interfaces	8 copper GE ports, 1 copper GE management port, 1 expansion slot
Stateful inspection throughput (maximum)	3 Gbps
3DES/AES VPN throughput	400 Mbps
IPsec VPN peers	2,500
Virtual interfaces (VLANs)	300
Memory	12 GB
Flash	8 GB
Height (rack units)	1 RU
Dimensions (D x H x W)	4.24 x 42.9 x 48.4 cm

### **Product Details**

Figure 1 shows the front panel of ASA5545-FPWR-K9.

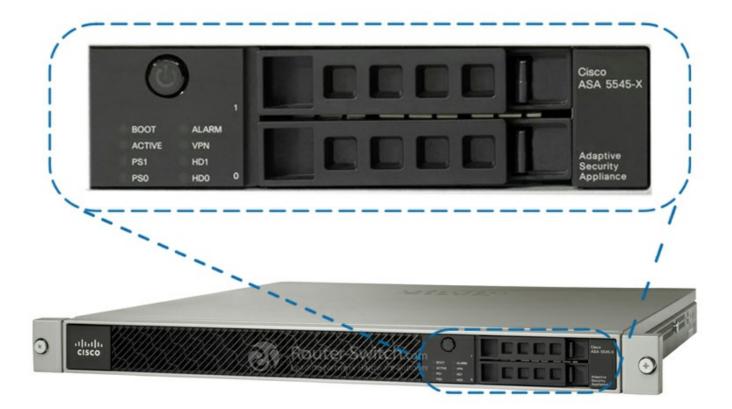


#### Table 2 shows the Front Panel LEDs' descriptions.

LED	Color	Description	
	Flashing green	Power-up diagnostics are running, or system is booting.	
BOOT	Solid green	System has passed power-up diagnostics.	
	Off	Power-up diagnostics are not operational.	
ACTIVE	Solid green	Failover pair is operating normally.	
AOIIIL	Off	Failover is not operational.	
PS	-	Power supply status	
	Off	Normal operating system function.	
ALARM	Solid amber	Critical Alarm indicating one or more of the following: -a major failure of a hardware or software component. -an over-temperature condition. -power voltage is outside of the tolerance range.	
VPN	Solid green	VPN tunnel is established.	
VEN	Off	No VPN tunnel established.	
	Flashing green	Proportioned to read/write activity.	
HD0	Solid amber	Hard-disk drive failure.	
	Off	No hard-disk drive present.	

		Flashing green	Proportioned to read/write activity.
ŀ	HD1	Solid amber	Hard-disk drive failure.
		Off	No hard-disk drive present.

Figure 2 shows the back panel of ASA5545-FPWR-K9.

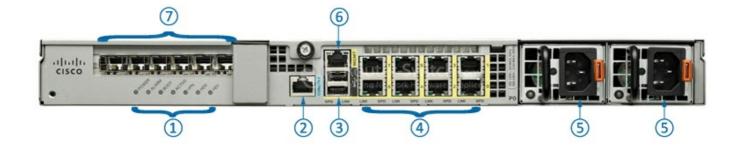

Note

(1)	LEDs	(5)	AC Socket
(2)	One Console port	(6)	one Management 0/0 interface
(3)	Two USB Ports	(7)	I/O slot
(4)	Eight Gigabit Ethernet data interfaces		

· There are seven LEDs on the back panel: POWER, ALARM, BOOT, ACTIVE, VPN, HD0 and HD1.

#### The Licenses

#### Table 3 shows the recommended licenses for ASA5545-FPWR-K9.

Licenses	Description
L-ASA5545-TA-3Y	Cisco ASA5545 FirePOWER IPS and Apps 3YR Subscription
L-ASA5545-TAC-3Y	Cisco ASA5545 FirePOWER IPS, Apps and URL 3YR Subscription
L-ASA5545-TAM-3Y	Cisco ASA5545 FirePOWER IPS, Apps and AMP 3YR Subscription
L-ASA5545-TAMC-3Y	Cisco ASA5545 FirePOWER IPS, Apps, AMP and URL 3YR Subscription
L-ASA5545-URL-3Y	Cisco ASA5545 FirePOWER URL Filtering 3YR Subscription

### **Compare to Similar Items**

Table 4 shows the comparison between ASA5545-FPWR-K9 and ASA5545-K9.

Models	ASA5545-FPWR-K9	ASA5545-K9
Firepower service	Yes	N/A
Next-generation firewall throughput (multiprotocol)	1 Gbps	1 Gbps
Memory	12GB	12GB
Flash	8GB	8GB

Height (ra	ck units)
------------	-----------

1RU

#### **Datasheet Download**

Cisco ASA 5500 with FirePOWER Services Datasheet.pdf

#### Get more information

Do you have any question of ASA5545-FPWR-K9?

Contact us now via Live Chat or sales@router-switch.com.

# Specification

ASA5545-FPWR-K9 Specifications		
Throughput: Application Control (AVC)	1,500 Mbps	
Throughput: Application Control (AVC) and IPS	1,000 Mbps	
Maximum concurrent sessions	750,000	
Maximum New Connections per second	30,000	
Supported applications	More than 3,000	
URL categories	80+	
Number of URLs categorized	More than 280 million	
Centralized configuration, logging, monitoring, and reporting	Multi-device Cisco Security Manager (CSM) and Cisco Firepower Management Center	
On-Device Management	ASDM	
Feature	Cisco ASA 5545-X w/ FirePOWER Services	
Stateful inspection throughput (maximum1)	3 Gbps	
Stateful inspection throughput (multiprotocol2)	1.5 Gbps	
Triple Data Encryption Standard/ Advanced Encryption Standard (3DES/AES) VPN throughput3	400 Mbps	
Users/nodes	Unlimited	
IPsec site-to-site VPN peers	2500	
Cisco AnyConnect Plus/Apex VPN maximum simultaneous connections5	25005	
Virtual interfaces (VLANs)	300	
Security contexts5(included; maximum)	2; 50	
High availability4	Active/ Active and Active/ Standby	
Integrated Wireless Access Point (See Cisco AP 702 datasheet for WiFi technical details)	N/A	
Expansion slot	1 interface card	
User-accessible Flash slot	-	

USB 2.0 ports	2
Integrated I/O	8 GE copper
Expansion I/O	6 GE copper or 6 GE SFP
Dedicated management port	Yes (1 GE)
Serial ports	1 RJ-45 console
Solid-state drive	2 slots, RAID 1 or 120 GB MLC SED
Memory	12 GB
System flash	8 GB
System bus	Multibus architecture
Temperature	23 to 104°F (-5 to 40°C)
Relative humidity	90 percent
Altitude	Designed and tested for 0 to 10,000 ft (3050 m)
Temperature7	-13 to 158°F (-25 to 70°C)
Relative humidity	10 to 90 percent
Altitude	Designed and tested for 0 to 15,000 ft (4572 m)
AC range line voltage	100 to 240 VAC
AC normal line voltage	100 to 240 VAC
AC current	5A, 100 to 120V or 2.5A, 200 to 240V
AC frequency	50/60 Hz
Dual-power supplies	Yes
DC domestic line voltage	-40.5 to 56 VDC (-48 VDC nominal)
DC international line voltage	-55 to -72 VDC (-60 VDC nominal)
DC current	15A (maximum input)
Steady state	86W
Maximum peak	125W
Maximum heat dissipation	427 Btu/hr
Form factor	1RU, 19-in. rack-mountable
Weight (with AC power supply)	16.82 lb (7.63 kg) with single power supply; 18.86 lb (8.61 kg) with dual power supply

# Want to Buy

Order Now

Get a Quote

# Why Router-switch.com

As a leading network hardware supplier, Router-switch.com focuses on original new ICT equipment of Cisco, Huawei, HPE, Dell, Hikvision, Juniper, Fortinet, etc.











## Contact Us

- Tel: +1-626-655-0998 (USA) +852-3050-1066 / +852-3174-6166
- Fax: +852-3050-1066 (Hong Kong)
- Email: sales@router-switch.com